

# Service Bulletin



Nr. / no. **013-2018**

Erstellt am / made on: **10-10-2018**

## Geräte/devices


- |   |   |   |   |   |                                  |                                  |
|---|---|---|---|---|----------------------------------|----------------------------------|
| <input type="checkbox"/> KD1x1                  | <input type="checkbox"/> KD2x2                | <input type="checkbox"/> KD3x3              | <input type="checkbox"/> KD3x3-F            | <input type="checkbox"/> KD4x4              | <input type="checkbox"/> KD4x4-F | <input type="checkbox"/> KDB/KDD |
| <input type="checkbox"/> HD Etronic I           | <input type="checkbox"/> HD Etronic II        | <input type="checkbox"/> HDE                | <input type="checkbox"/> HDE-F              | <input type="checkbox"/> HDB/HDD            | <input type="checkbox"/> KW      |                                  |
| <input type="checkbox"/> KS                     | <input type="checkbox"/> KSM                  | <input type="checkbox"/> HSC                | <input type="checkbox"/> MP                 |   |                                  |                                  |
| <input checked="" type="checkbox"/> SmartWash   | <input checked="" type="checkbox"/> SW Plus   | <input checked="" type="checkbox"/> JetWash | <input checked="" type="checkbox"/> JW Plus | <input checked="" type="checkbox"/> CW Plus |                                  |                                  |
| <input checked="" type="checkbox"/> CompactLine | <input checked="" type="checkbox"/> ModulLine | <input checked="" type="checkbox"/> Vacs    |   |   |                                  |                                  |

### Störung bei der Münzannahme des Münzprüfers Version V7


In einzelnen Fällen kann es beim Münzprüfer Version V7, der ein anderes Messsystem hat, zu einer Störung kommen, durch die einzelne Münzen nicht korrekt angenommen werden. Durch Austausch der Version V7 durch die Version V6 kann das Problem behoben werden. Beantragen Sie hierzu über unsere Internetseite eine RMA Nummer. Nach der Prüfung und Sachstandsermittlung erhalten Sie im Garantiefall einen Rücksendeaufkleber und -schein.

### Malfunction at the coin acceptance of the coin validator version V7

In individual cases, the coin acceptor version V7, which has a different measuring system, may experience a malfunction which may result in individual coins not being accepted correctly. The problem can be solved by replacing version V7 with version V6. You can apply for an RMA number on our website for this purpose. After the inspection and determination of the status you will receive a return sticker and return note in case of a warranty claim.

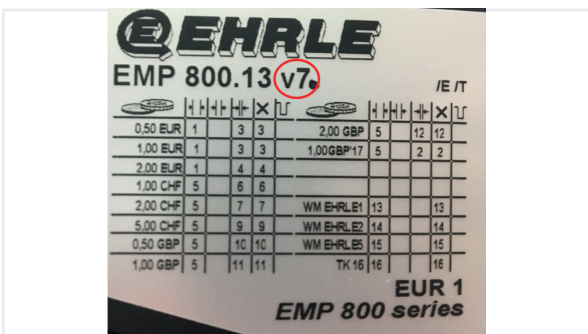

Münzprüfer Version 7  
Coin acceptor version 7

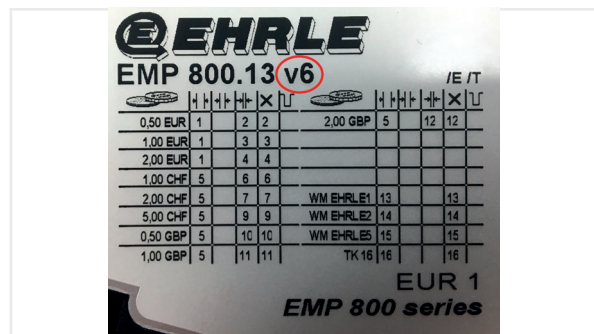

Münzprüfer Version 6  
Coin acceptor version 6

Anlage / attachment **keine / none**

geprüft am / checked on:  
**10-10-2018**

genehmigt von / approved by:  
**Dominik Häusler**